



1 PREPARE 2 TREAT 3 MAINTAIN

HARDWAX OIL EXTREME

APPLICATION AREA

Hardwax Oil Extreme is for untreated, new or newly-sanded wooden surfaces.

It can also be used as a topcoat on top of WOCA Master Colour Oil.

RESULT

Hardwax Oil Extreme ensures an extremely robust and resistant surface that is well-protected against spills and stains.

The oil emphasises the natural glow of the wood, leaving a comfortable anti-slip surface that is easy to maintain.

Product information

Coverage: 20 m²/L
Packaging: 0.75 and 2.5 L
Available in Natural and White



resistance

Extreme resistance

Very robust surface with extremely high resistance to spills, stains, marks and scratches.



tool

Buffer

Smooth and easy to rub into the floor.



appearance

Natural appearance

Gives the wood a natural appearance and breathable surface.



maintenance

Easy to maintain

No special tool required. Just use the standard WOCA system.



Natural

White



HOW TO...

...DO THE BASIC TREATMENT OF WOODEN FLOORS

Tools

- Either polishing machine or doodlebug for the manual finishing
- Paint roller and cotton cloths
- Clean tools with WOCA Solvent

Preparation

The floor must be free of dirt, grease, wax and sanding residue. Previously treated floors should be sanded down to bare wood with grit 120-150. Vacuum thoroughly and wipe the floor down afterwards if necessary, using a tightly-wrung water-soaked cloth.




It is important that the product, the room and the floor are at a temperature between 15 °C and 30 °C and that air humidity is approx. 50%. Wood humidity must not exceed 12%. Make sure that the room is well-ventilated for optimal evaporation and drying time.

Please note

Do not expose the floor to water or clean it for the first 7 days, while the oil is hardening.

Maintenance and cleaning

For the cleaning, we recommend using WOCA Natural Soap or WOCA Oil Refreshing Soap, and for the maintenance we recommend WOCA Oil Care. Re-oil with Hardwax Oil Extreme or WOCA Maintenance Gel as required.

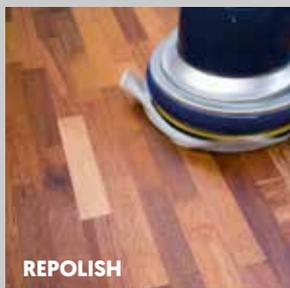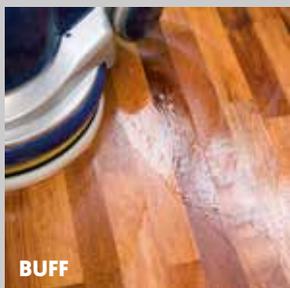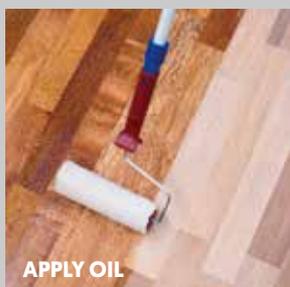

INSTRUCTIONS

- 1 Wash the floor with WOCA Intensive Wood Cleaner. Leave the floor to dry for at least 8 hours before applying the oil.
- 2 Hardwax Oil Extreme should be stirred thoroughly before and during use. Containers with different batch numbers should be mixed to avoid colour mismatch. Apply a thin and even coat of oil with a short-bristled paint roller (3-4 mm) to a small area of the floor at a time (5-10 m²). Distribute the oil thoroughly.
- 3 Leave the oil to stand on the surface for 5-10 minutes, while shiny. If the oil soaks quickly into the wood, apply more oil.
Please note: After approx. 15 minutes, Hardwax Oil Extreme will begin to seal on the surface.
- 4 Buff the surface with a white or beige buffer pad until the wood appears saturated. Then buff with a clean lint-free cotton cloth to remove excess oil before proceeding to the next section. The surface should not appear wet and no excess oil should remain on the surface.
- 5 Leave the floor to dry for 8-10 hours. Drying time will vary by temperature, humidity and application quantity. Lower temperatures and/or higher humidity can extend drying time.
- 6 Repeat steps 2-4 if a second layer of oil is required or if you want a higher gloss or tougher surface. A single coat of oil is normally enough for previously-oiled surfaces.
- 7 The newly-oiled floor can be used with caution the following day.
- 8 Clean tools with WOCA Solvent.